

November 24, 1954.


TECHNICAL BUILLETIN NO. 4

Adjustment of Perspecta Sound carrier meters on the integrator should be with use of the 30-35-40 cycle tones of the calibration films only.

When using the ODS:1 (or Altec 50) calibration film, adjust the meters on signals 2 (30 cycles), 3 (35 cycles) and 4 (40 cycles) only.

When using the P l calibration film adjust the carrier meters on signals 2 (35 cycles), 4 (30 cycles) and 6 (40 cycles) only. Do not readjust on signals 3, 5 or 7.

In those cases where readjustment has been made contrary to above instruction the pictures with Perspecta track are unable to produce carrier meter readings of approximately "50" for pictures produced with the new recording standards or carrier meter readings of approximately "65" for pictures produced with the old recording standards.

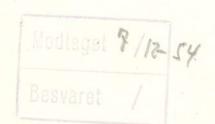

PERSPECTA SOUND INC. 711 Fifth Avenue New York 20, N.Y.